

Handy Calibrators


CA51/CA71

- Source and measure operations can be performed at the same time.
(Select from the following source signal and measurement signal options: voltage, current, resistance, thermocouple (TC), resistance temperature detector (RTD), frequency, pulse).
- AC voltages, including supply voltage, can be measured.
- Includes a wide array of additional functions.
- Easy operation.
- Compact size and Lightweight



Actual Size

Panel layout

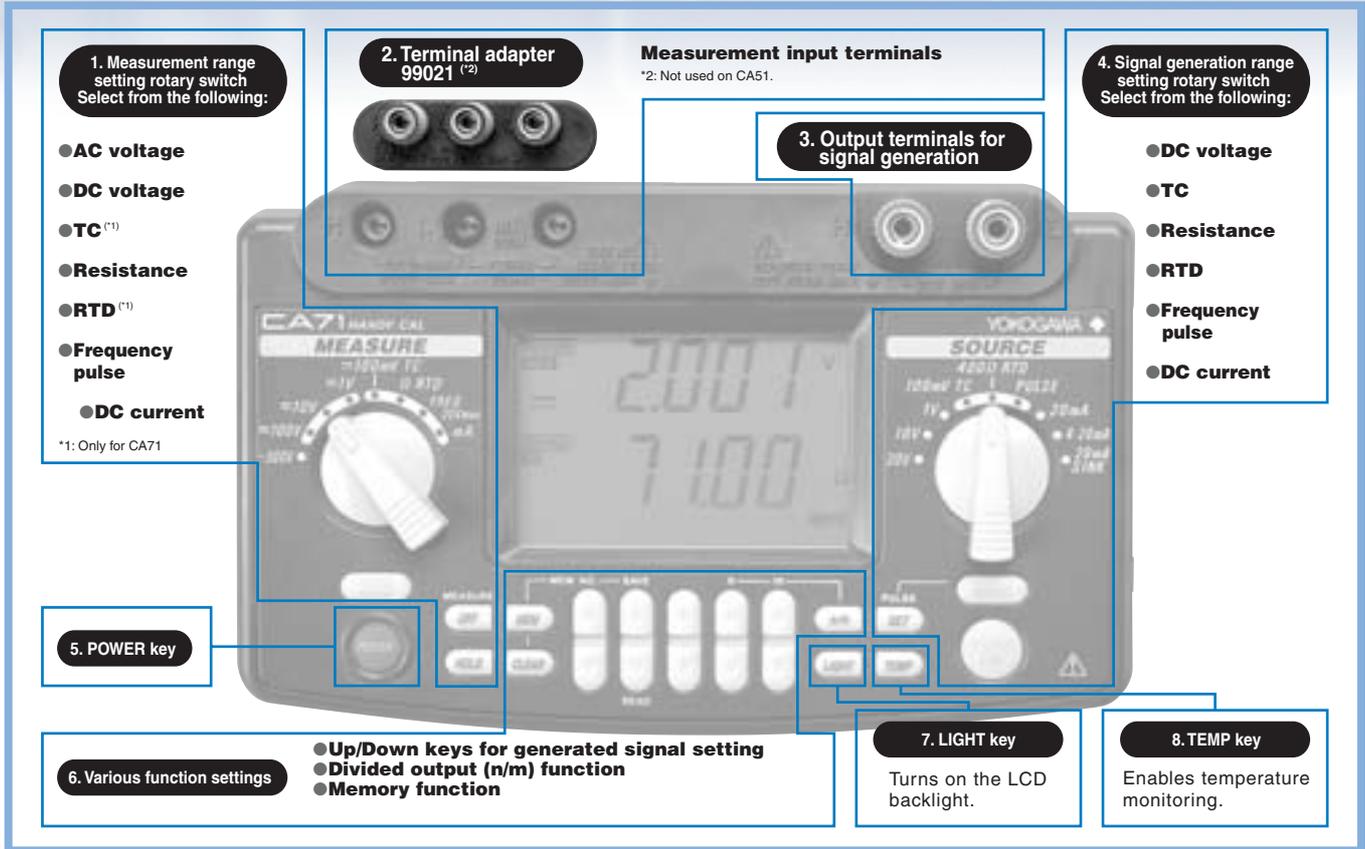

● Spare parts

| Product | Source signal lead cable | Measurement lead cable | Carrying case | Terminal adapter | Fuse |
|---------|-----------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------|----------------------------------------------------|
| | | | | | |
| Model | 98020 | RD031 | 93016 | 99021 | A1501EF |
| Remarks | One set, including one red cable and two black cables. Length: approximately 1.7 meters | One set, including one red cable and one black cable. Length: approximately 1.0 meter | The carrying case can hold the source signal and measurement lead cables, terminal adapter, four spare batteries, fuses, AC adapter, and user's manual. | Used in temperature measurement (for CA71). | For current terminal input protection. (10pcs/set) |

● Optional accessories (sold separately)

| Product | AC adapter | RJ sensor | Accessory carrying case | Communication cable (RS232) |
|---------|--------------------------------------------------------------------------------------------------------------------------------|-------------------------------------|---------------------------------------|-----------------------------|
| | | | | |
| Model | A1020UP, A1022UP, B9108WB | B9108WA | B9108XA | 91017 |
| Remarks | A1020UP: 100 V AC power supply adapter A1022UP: 120 V AC power supply adapter B9108WB: 220-240 V AC power supply adapter | For reference junction compensation | Can hold lead cables, RJ sensor, etc. | D-sub 9-pin (female) |

● Handy Calibrator main unit

| Product | CA71 Handy Calibrator | CA51 Handy Calibrator |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------|
| | | |
| Model | CA71 | CA51 |
| Standard accessories | All of the following are included: Source signal lead cables (one red, two black): 98020 Measurement lead cables (one red, one black): RD031 Carrying case: 93016 Terminal adapter for CA71: 99021 User's manual: IM CA71-E Fuse: A1501EF (for current terminal input protection) Four AA alkaline batteries: A1070EB x4 | |

● Related product

| Product | Handy Calibrators | Handy Calibrator |
|---------|----------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------|
| | | |
| Model | CA11E/CA12E | CA150 |
| Remarks | CA11E: Voltage/current model CA12E: Temperature model | Multi-functional Hand-held Calibrator Source and measurement can be performed simultaneously. Loop power supply function Sink function |

CA51/CA71

Handy Calibrators

Comprehensive source/measure instruments for all your calibration and equipment checking needs at maintenance sites

Sensors and instruments require a wide variety of operation checks in the field. The CA71 Handy Calibrator is a small, lightweight, multifunction calibrator that can simultaneously source and measure voltage, current, resistance, TC, RTD, frequency, and pulse signals. The CA51 Handy Calibrator is a basic model with the same functions as the CA71 except TC and RTD measurement functions and online communication functions.

Simultaneous signal source and measurement capability

The CA71 lets you handle regular tests on TCs, RTDs and various other types of sensors and instruments, as well as operation checks when a problem has occurred. By itself it can source signals for input to equipment, and check output signal from equipment. With the CA71, you don't need to worry about synchronizing operations with other setting devices. (TC and RTD measurement functions are CA71 only.)



AC voltage (including supply voltage) measurement capability

In cases where numerous signal converters and other devices are mounted on a rack or panel, the Handy Calibrator can be used to check the input and output signals of each device, while simultaneously checking the power supply. There is no need for a separate multimeter to measure supply voltage.



A wide array of useful functions

• Source

Values set in steps of 4–20 mA
24V DC Power Supply to Transmitter

• Divided output (n/m) function

Output settings are divided, eliminating the need for bothersome calculations for percentage output.

• Autostep function

Changes the output value in step form based on the setting from the divided output (n/m) function. Changes can be sourced automatically every 10% or 25%.

• Online communication (CA71 only)

RS-232C-compliant optically isolated interface

• Sweep function

Linearly increases or decrease the output. The increasing/decreasing time can be set to either 16 or 32 seconds.

• Memory function

Source values and measurements forming individual value sets can be saved to or read from the Handy Calibrator's internal memory (maximum 50 value sets).

• Temperature monitor function

Easy operation

The Handy Calibrator incorporates rotary switches for simple handling. Just open the carrying case cover and connect the cables, and you're ready to take measurements.



CA51 and CA71 Specifications

Signal sourcing unit range and accuracy (for both CA51 and CA71)

±(setting percentage plus μV , mV , mA , Ω or $^{\circ}\text{C}$)

| Parameter | Reference | Range | Accuracy (23.5°C per year) | Resolution | Remarks |
|------------------|----------------|------------------------------------------------------------|------------------------------------------------------------|------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| DC voltage | 100 mV | -10.00~110.00 mV | $\pm(0.02\% + 15 \mu\text{V})$ | 10 μV | |
| | 1 V | 0~1.1000 V | $\pm(0.02\% + 0.1 \text{ mV})$ | 0.1 mV | Maximum output: 5 mA |
| | 10 V | 0~11.000 V | $\pm(0.02\% + 1 \text{ mV})$ | 1 mV | Maximum output: 10 mA |
| | 30 V | 0~30.00 V | $\pm(0.02\% + 10 \text{ mV})$ | 10 mV | Maximum output: 10 mA ** |
| DC current | 20 mA | 0~24.000 mA | $\pm(0.025\% + 3 \mu\text{A})$ | 1 μA | Maximum load: 12 V |
| | 4~20 mA | 4/8/12/16/20 mA | | 4 mA | |
| mA SINK | 20 mA | 0.1~24.000 mA | $\pm(0.05\% + 3 \mu\text{A})$ | 1 μA | External power supply: 5~28 V |
| Resistance | 400 Ω | 0~400.00 Ω | $\pm(0.025\% + 0.1 \Omega)$ | 0.01 Ω | Excitation current: 0.5~5 mA *3 If 0.1 mA, add 0.25 Ω or 0.6°C. Subject device input capacitance: 0.1 μF or less |
| RTD | Pt100 *2 | -200.0~850.0°C | $\pm(0.025\% + 0.3^{\circ}\text{C})$ | 0.1°C | TC source accuracy does not include RJ sensor accuracy. RJ sensor specs Measurement range: -10~50°C Accuracy (when combined with main unit) 18~28°C: $\pm 0.5^{\circ}\text{C}$ Other than the above: $\pm 1^{\circ}\text{C}$ |
| | JPt100 | -200.0~500.0°C | | | |
| | K | -200.0~1372.0°C | $\pm(0.02\% + 0.5^{\circ}\text{C})$ (-100°C or greater) | 0.1°C | |
| | E | -200.0~1000.0°C | $\pm(0.02\% + 1^{\circ}\text{C})$ (-100°C or less) | | |
| | J | -200.0~1200.0°C | $\pm(0.02\% + 0.5^{\circ}\text{C})$ (0°C or greater) | | |
| | T | -200.0~400.0°C | $\pm(0.02\% + 1^{\circ}\text{C})$ (100°C or less) | | |
| | N | -200.0~1300.0°C | $\pm(0.02\% + 1.5^{\circ}\text{C})$ (100°C or greater) | | |
| | L | -200.0~900.0°C | $\pm(0.02\% + 1^{\circ}\text{C})$ (1000°C or less) | | |
| | U | -200.0~400.0°C | $\pm(0.02\% + 2.5^{\circ}\text{C})$ (1000°C or less) | | |
| | R | 0~1768°C | $\pm(0.02\% + 1.5^{\circ}\text{C})$ (100°C or greater) | | |
| S | 600~1800°C | $\pm(0.02\% + 1.5^{\circ}\text{C})$ (1000°C or less) | | | |
| B | 600~1800°C | $\pm(0.02\% + 1.5^{\circ}\text{C})$ (1000°C or greater) | | | |
| Frequency, pulse | 500 Hz | 1.0~500.0 Hz | $\pm 0.2 \text{ Hz}$ | 0.1 Hz | Output voltage: +0.1~+15 V (zero base waveform) Amplitude accuracy: $\pm(5\% + 0.1 \text{ V})$ Maximum load current: 10 mA |
| | 1000 Hz | 90~1100 Hz | $\pm 1 \text{ Hz}$ | 1 Hz | Contact output (with 0.0 V amplitude setting, FET switch ON/OFF) |
| | 10 kHz | 0.9 kHz~11.0 kHz | $\pm 0.1 \text{ kHz}$ | 0.1 kHz | Maximum open/close voltage/current: +28 V/50 mA |
| | Pulse cycle *5 | 1~99,999 cycles | - | 1 cycle | |

Temperature coefficient: Accuracy shown above $\times (1/5)^{\circ}\text{C}$

*1: Output up to 24 V/22 mA is possible when using the AC adapter.

*2: As per JIS C 1604-1997 (ITS-90), IPTS-68 may be selected through internal settings (DIP switch).

*3: Excitation current. If less than 0.1 mA to 0.5 mA, then add [0.025% (mA)] Ω or [0.06% (mA)] $^{\circ}\text{C}$.

*4: As per JIS C 1602-1995 (ITS-90) (L and U are DIN specs).

K, E, J, T, N, R, S, and B may be switched to IPTS-68 through internal settings (DIP switch) (L and U are not switched).

*5: Frequency (interval between one pulse and another) and amplitude during pulse cycle generation may have the same range as during frequency generation.

General specifications (for both CA51 and CA71)

| Parameter | Specification |
|----------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Signal generating unit response time | Approximately 1 second (time between start of voltage change and when voltage enters accuracy range) |
| Signal generating unit voltage limiter | Approximately 32 V |
| Signal generating unit current limiter | Approximately 25 mA |
| Divided output (n/m) function | Output = setting $\times (n/m)$ $n = 0\sim m$; $m = 1\sim 19$; $n \leq m$ |
| Auto-step output function | n value sent automatically when n/m function selection is selected (two options: approximately 2.5 seconds/step or approximately 5 seconds/step) |
| Sweep function | Sweep time (two options: approximately 16 seconds or approximately 32 seconds) |
| Memory function | 50 value sets (generated and measured values are stored as value sets with the same address (up to 50 value sets can be stored)) |
| Measuring unit maximum input | Voltage terminal: 300 V AC Current terminal: 120 mA DC |
| Current terminal input protection | Fuses: 125 mA/250 V |
| Measuring unit ground voltage | Maximum 300 V AC |
| Measurement display updating rate | Approximately once per second |
| Serial interface | Enabled when communication cable (RS232) is connected; sold separately as optional accessory (CA71 only) |
| Display | Segmented LCD (approximately 76 mm \times 48 mm) |
| Backlight | LED backlight; auto-off after one minute (from when LIGHT key is turned on) |
| Power supply | Four AA alkaline batteries, or special AC adapter (sold separately) |
| Battery life | Measurement off, output 5 V DC/10 k Ω or greater: Approximately 40 hours Simultaneous signal generation/measurement, output 5 V DC/10 k Ω or greater: Approximately 20 hours Simultaneous signal generation/measurement, output 20 mA/5 V: Approximately 12 hours (using alkaline batteries, with backlight off) |
| Consumed power | Approximately 7 VA (using 100 V AC adapter) |
| Auto-power-off function | Approximately 10 minutes (auto-power-off can be disabled through a DIP switch setting) |
| Applicable standards | IEC61010-1, IEC61010-2-31 EN61326-1 EN55011, Class B, Group 1 |
| Insulation resistance | Across input terminal and output terminal, 500 V DC, 50 M Ω or greater |

Measurement unit range and accuracy (for both CA51 and CA71)

Accuracy: \pm (reading percentage plus μV , mV , μA , Ω or dgt (digit))

| Parameter | Reference | Range | Accuracy (23.5°C per year) | Resolution | Remarks |
|------------------|--------------|----------------------------|---------------------------------|------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| DC voltage | 100 mV | 0~ $\pm 110.00 \text{ mV}$ | $\pm(0.025\% + 20 \mu\text{V})$ | 10 μV | Input resistance: 10 M Ω or greater |
| | 1 V | 0~ $\pm 1.1000 \text{ V}$ | $\pm(0.025\% + 0.2 \text{ mV})$ | 0.1 mV | |
| | 10 V | 0~ $\pm 11.000 \text{ V}$ | $\pm(0.025\% + 2 \text{ mV})$ | 1 mV | Input resistance: Approximately 1 M Ω |
| | 100 V | 0~ $\pm 110.00 \text{ V}$ | $\pm(0.05\% + 20 \text{ mV})$ | 0.01 V | |
| DC current | 20 mA | 0~ $\pm 24.000 \text{ mA}$ | $\pm(0.025\% + 4 \mu\text{A})$ | 1 μA | Input resistance: Approximately 14 Ω |
| | 100 mA | 0~ $\pm 100.00 \text{ mA}$ | $\pm(0.04\% + 30 \mu\text{A})$ | 10 μA | |
| Resistance | 400 Ω | 0~400.00 Ω | $\pm(0.05\% + 0.1 \Omega)$ | 0.01 Ω | Accuracy during 3-wire measurement |
| | 1 V | 0~1.100 V | $\pm(0.5\% + 5 \text{ dgt})$ | 1 mV | Input resistance: Approximately 10 M Ω /10 pF Input voltage range: 10%~100% Measurement method: Average value rectification |
| | 10 V | 0~11.000 V | | 0.01 V | |
| | 100 V | 0~110.00 V | | 0.1 V | |
| 300 V | 0~300 V | 1 V | | | |
| Frequency, pulse | 100 Hz | 1.00~100.00 Hz | $\pm 2 \text{ dgt}$ | 0.01 Hz | Maximum input: 30 V peak Input resistance: 200 k Ω or greater Sensitivity: 0.5 V peak or greater Contact input: Maximum 100 Hz Notes CPM: Counts per minute CPH: Counts per hour |
| | 1000 Hz | 1.0~1000.0 Hz | | 0.1 Hz | |
| | 10 kHz | 0.001~11.000 kHz | | 0.001 kHz | |
| | CPM | 0~99,999 CPM | | 1 CPM | |
| | CPH | 0~99,999 CPH | | 1 CPH | |

Temperature coefficient: Accuracy shown above $\times (1/5)^{\circ}\text{C}$

Measurement unit (temperature; CA71 only) range and accuracy

Accuracy: \pm (reading percentage + $^{\circ}\text{C}$)

| Parameter | Reference | Range | Accuracy (23.5°C per year) | Resolution | Remarks |
|-----------|-----------|-----------------|------------------------------------------------------------|------------|------------------------------------|
| TC *7 | K | -200.0~1372.0°C | $\pm(0.05\% + 1.5^{\circ}\text{C})$ (-100°C or greater) | 0.1°C | |
| | E | -200.0~1000.0°C | | | |
| | J | -200.0~1200.0°C | | | |
| | T | -200.0~400.0°C | | | |
| | N | -200.0~1300.0°C | | | |
| | L | -200.0~900.0°C | | | |
| | U | -200.0~400.0°C | | | |
| | R | 0~1768°C | | | |
| | S | 0~1768°C | | | |
| | B | 600~1800°C | | | |
| RTD | Pt100 *6 | -200.0~850.0°C | $\pm(0.05\% + 0.6^{\circ}\text{C})$ | 0.1°C | Accuracy during 3-wire measurement |
| | JPt100 | -200.0~500.0°C | | | |

Temperature coefficient: Accuracy shown above $\times (1/5)^{\circ}\text{C}$

*6: As per JIS C 1604-1997 (ITS-90), IPTS-68 may be selected through internal settings (DIP switch).

*7: As per JIS C 1602-1995 (ITS-90) (L and U are DIN specs).

K, E, J, T, N, R, S, and B may be switched to IPTS-68 through internal settings (DIP switch) (L and U are not switched).

| Parameter | Specification |
|-------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Withstand voltage | Across input terminal and output terminal, 3.7 kVAC, for one minute |
| Operating temperature and humidity ranges | 0~50°C, 20~80% RH (no condensation) |
| Storage temperature and humidity ranges | -20~50°C, 90% RH or less (no condensation) |
| External dimensions (WHD) | Approximately 190 \times 120 \times 55 mm |
| Weight | Approximately 730 g (including batteries) |
| Standard accessories | All of the following are included: Signal generating lead cables (one red, two black): 98020 Measurement lead cables (one red, one black): RD031 Carrying case: 93016 Terminal adapter for CA71: 99021 User's manual: IM CA71-E Fuse: A1501EF (for current terminal input protection) Four AA alkaline batteries: A1070EB \times 4 |
| Optional accessories (sold separately) | AC adapter: A1020UP (100 V AC power supply) AC adapter: A1022UP (120 V AC power supply) AC adapter: B9108WB (220~240 V AC power supply) RJ sensor: B9108WA (For reference junction compensation) Accessory carrying case: B9108XA Communication cable: 91017 |
| Spare parts | Signal generating lead cables (one red, two black): 98020 Measurement lead cables (one red, one black): RD031 Carrying case: 93016 Terminal adapter: 99021 Fuse: A1501EF (for current terminal input protection) |

NOTICE

- Before using the product, read the instruction manual carefully to ensure proper and safe operation.

Represented by:

MIK-ES15

YOKOGAWA
Yokogawa Meters & Instruments Corporation

World Wide Web site at
<http://www.yokogawa.com/MCC>

YOKOGAWA METERS & INSTRUMENTS CORPORATION Tachih Bld. No.2, 6-1-3 Sakaecho, Tachikawa-shi, Tokyo, 190-8586 Japan
International Sales Dept. Phone: +81-42-534-1413 Facsimile: +81-42-534-1426

YOKOGAWA CORPORATION OF AMERICA (U.S.A.)
YOKOGAWA EUROPE B. V. (THE NETHERLANDS)
YOKOGAWA ENGINEERING ASIA PTE. LTD. (SINGAPORE)
YOKOGAWA AMERICA DO SUL LTDA (BRAZIL)
YOKOGAWA MEASURING INSTRUMENTS KOREA CORPORATION (KOREA)
YOKOGAWA AUSTRALIA PTY. LTD. (AUSTRALIA)
YOKOGAWA INDIA LTD. (INDIA)
YOKOGAWA SHANGHAI TRADING CO., LTD. (CHINA)
YOKOGAWA MIDDLE EAST E.C. (BAHRAIN)
YOKOGAWA ELECTRIC CIS LTD. (RUSSIAN FEDERATION)

Phone: +1-770-253-7000
Phone: +31-334-64-1611
Phone: +65-6241-9933
Phone: +55-11-5681-2400
Phone: +82-2-551-0660
Phone: +61-2-8870-1100
Phone: +91-80-4158-6000
Phone: +86-21-6880-8107
Phone: +973-358100
Phone: +7-095-737-7868

Facsimile: +1-770-251-2088
Facsimile: +31-334-64-1610
Facsimile: +65-6241-2606
Facsimile: +55-11-5681-1274/4434
Facsimile: +82-2-551-0665
Facsimile: +61-2-8870-1111
Facsimile: +91-80-2852-1441
Facsimile: +86-21-6880-4987
Facsimile: +973-336100
Facsimile: +7-095-737-7869

Subject to change without notice.
All Rights Reserved. Copyright © 2002, Yokogawa Meters & Instruments Corporation.

[Ed: 03/b]

Printed in Japan: Sep. 2007(C)/2,000(KP)